

PRESTO-WELD DRIP EDGE

WITH FACTORY APPLIED TPO OR PVC FLASHING, WITHOUT CONTINUOUS CLEAT

NOTE: INSTALL MITERS FIRST

INSTALLATION INSTRUCTIONS

MEMBRANE $\frac{1}{2}$ " PAST NAILER

1. ROOF MEMBRANE
POSITION MEMBRANE OVER THE ROOF EDGE AND DOWN OUTSIDE FACE OF WALL, COVERING WOOD NAILER(S) COMPLETELY. ALLOW $\frac{1}{2}$ " EXCESS MEMBRANE.

ROLL BACK FLASHING TO FASTEN DRIP EDGE

2. DRIP EDGE
PLACE DRIP EDGE ON WALL. ROLL BACK FLASHING TO EXPOSE FASTENING SLOTS AND FASTEN THRU PRE-SLOTTED HOLES 6" WITH PROVIDED NAILS.

$\frac{1}{8}$ " TO $\frac{1}{4}$ " SPACE

3. DRIP EDGE
CONTINUE INSTALLING LENGTHS OF DRIP EDGE. LEAVE A $\frac{1}{8}$ " TO $\frac{1}{4}$ " SPACE BETWEEN PIECES.

3" WIDE FOIL TAPE

4. FOIL TAPE AT JOINT
PLACE A 3" WIDE PIECE OF FOIL TAPE OVER JOINT.

EXTEND AND HEAT WELD MEMBRANE 3" PAST FACTORY INSTALLED FLASHING

HEAT WELD MEMBRANE $\frac{1}{2}$ " ALONG BOTH EDGES DO NOT WRAP AROUND BOTTOM OF DRIP

5. JOINT MEMBRANE
HEAT WELD A 8" WIDE PIECE OF NON-REINFORCED MEMBRANE OVER JOINT AS SHOWN ABOVE.

HOT AIR WELD ALONG LENGTH OF DRIP EDGE

APPLY CUT EDGE SEALANT ALONG EDGE IN AREAS OF PONDING WATER ONLY

6. FLASHING
HOT AIR WELD ALONG ENTIRE LENGTH OF DRIP EDGE PER MANUFACTURERS INSTRUCTIONS. APPLY CUT EDGE SEALANT ONLY TO EDGES WHERE PONDING OCCURS.

PRESTO-WELD DRIP EDGE

WITH FACTORY APPLIED TPO OR PVC FLASHING, WITHOUT CONTINUOUS CLEAT

NOTE: INSTALL MITERS FIRST

INSTALLATION INSTRUCTIONS

TYPICAL INSTALLATION

