
SOPRA-TITE GOLD COPING

TAPERED VERSION - 4'-0" O.C.



FM

APPROVED

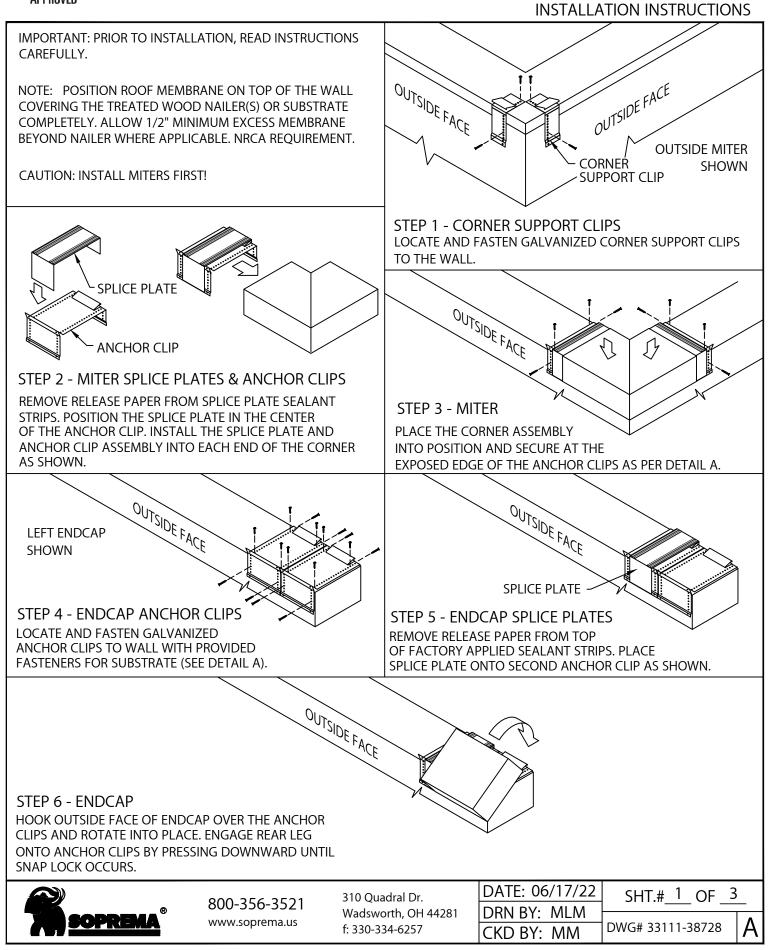

SOPRA-TITE GOLD COPING TAPERED VERSION - 4'-0" O.C.


INSTALLATION INSTRUCTIONS

4'-0" O.C.



1) Installing contractor shall check as-built conditions, including nailer attachment, and verify the manufacturer's coping details for accuracy to fit the wall assembly prior to fabrication.

2) Fasteners must be corrosion resistant and rated for a minimum 250# pullout force for the substrate that is being used.

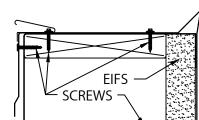


OUTSIDE FACE

SPLICE PLATE


PLACE SPLICE PLATE ONTO ANCHOR CLIPS

STEP 8 - SPLICE PLATES

 AT SPLICE JOINTS, 12'-0" O.C.



If using an EIFS system, fasten through face w/ fastener of proper length to penetrate through EIFS and attach into structural component

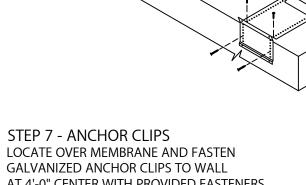

OUTSIDE FACE

AT 4'-0" CENTER WITH PROVIDED FASTENERS AS SHOWN IN DETAIL A.

OUTSIDE FACE

STEP 9 - COPING HOOK OUTSIDE FACE OF COPING OVER THE ANCHOR CLIPS AND ROTATE INTO PLACE. ENGAGE REAR LEG ONTO ANCHOR CLIPS BY PRESSING DOWNWARD UNTIL SNAP LOCK OCCURS.

STEP 10 - COMPLETION 3/8" SPACE CONTINUE INSTALLING COPING WITH A 3/8" SPACE AT SPLICE JOINTS TO ALLOW FOR THERMAL EXPANSION. FIELD CUT WHERE NECESSARY USING FINE TOOTH HACKSAW OR SNIPS.

NOTE: REMOVE RELEASE PAPER FROM SEALANT STRIPS.

NOTE: REMOVE PROTECTIVE FILM IMMEDIATELY.

	800-356-3521 www.soprema.us	310 Quadral Dr. Wadsworth, OH 44281 f: 330-334-6257	DATE: 06/17/22	SHT.# 2 OF 3	
			DRN BY: MLM	DWG# 33111-38728	
			CKD BY: MM		A

