

PLEASE READ

TECH BULLETIN: “PINKING” OF TPO PRODUCTS

You may notice a pink, red or orangish coloration called "pinking" on the surface of TPO products and samples. Please note that this is a **temporary** coloration. The “pinking” **will** go away within 24 hours of being installed once it is exposed to UV light. It’s important that the product is **installed** and **exposed completely** for the UV light to reach the full product.

Many TPO products contain a stabilization/weathering package which includes very powerful antioxidants that help protect the finished product from degradation due to heat induced thermal oxidation and sunlight induced photo-oxidation. Certain antioxidants in some weathering packages are particularly effective, but they are susceptible to pinking under the right environmental conditions, usually during storage. Pinking or "gas fading" is a surface reaction of these antioxidants with air pollutants, mostly nitrous oxides and sulfur oxides, produced in combustion processes. Pinking occurs over time on unweathered TPO surfaces that are exposed to polluted air, particularly in the absence of light.


As mentioned this is a temporary condition. The pinking will disappear upon exposure to sunlight and weathering in general once the product is completely installed. The products are not stained or permanently discolored in any way.

GENFLEX TPO SKIRTED DRIP EDGE

TPO VERSION WITH FACTORY APPLIED TPO FLASHING WITHOUT CONTINUOUS CLEAT


NOTE: INSTALL MITERS FIRST

INSTALLATION INSTRUCTIONS

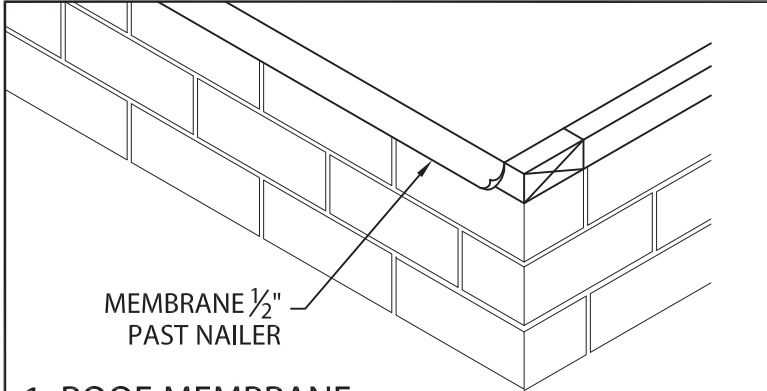


1. ROOF MEMBRANE

POSITION MEMBRANE OVER THE ROOF EDGE AND DOWN OUTSIDE FACE OF WALL, COVERING WOOD NAILER(S) COMPLETELY. ALLOW $\frac{1}{2}$ " EXCESS MEMBRANE.

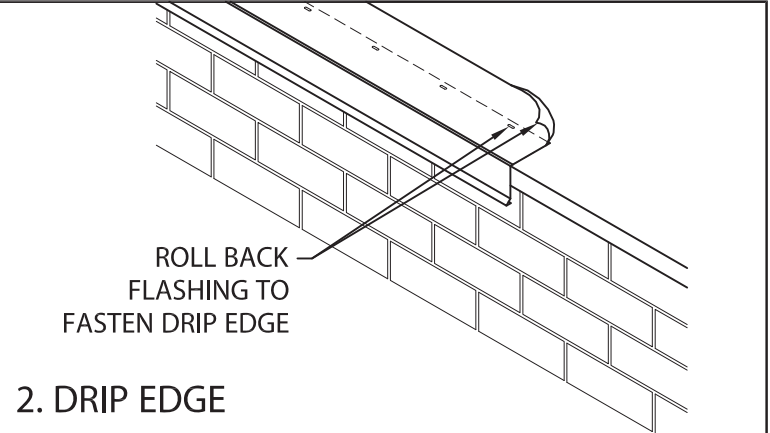


2. DRIP EDGE

PLACE DRIP EDGE ON WALL. ROLL BACK FLASHING TO EXPOSE FASTENING SLOTS AND FASTEN THRU PRE-SLOTTED HOLES 6" WITH PROVIDED NAILS.

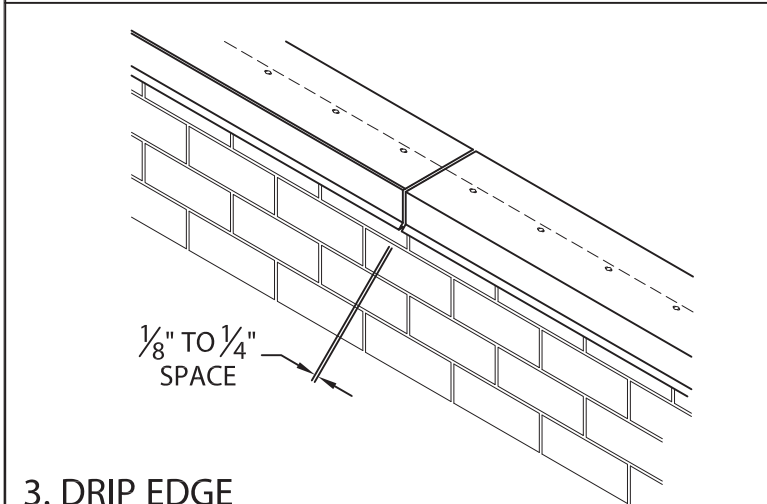


3. DRIP EDGE

CONTINUE INSTALLING LENGTHS OF DRIP EDGE. LEAVE A $\frac{1}{8}$ " TO $\frac{1}{4}$ " SPACE BETWEEN PIECES.

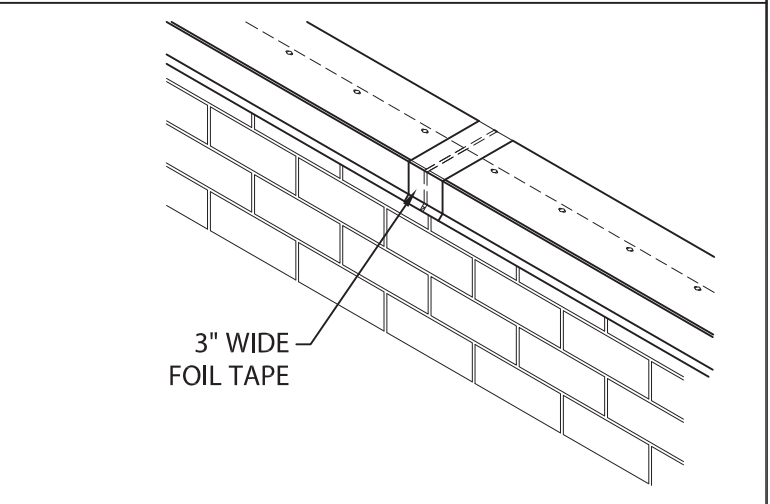


4. FOIL TAPE AT JOINT

PLACE A 3" WIDE PIECE OF FOIL TAPE OVER JOINT.

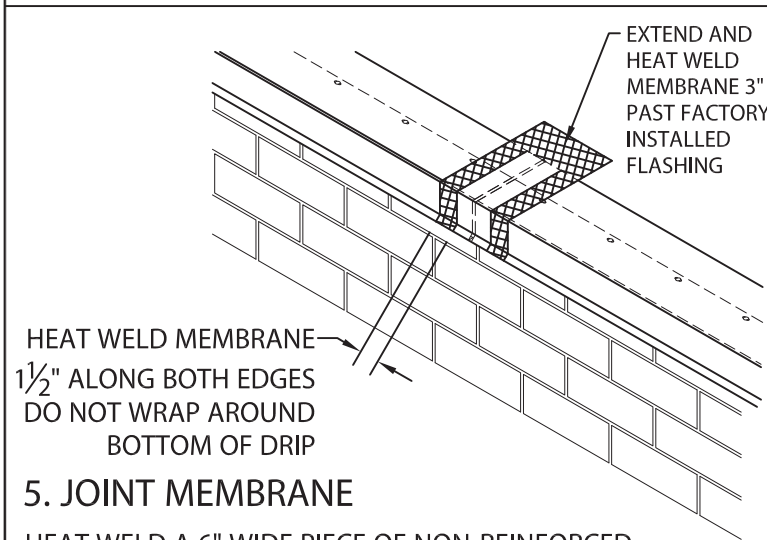

5. JOINT MEMBRANE

HEAT WELD A 6" WIDE PIECE OF NON-REINFORCED MEMBRANE OVER JOINT AS SHOWN ABOVE.

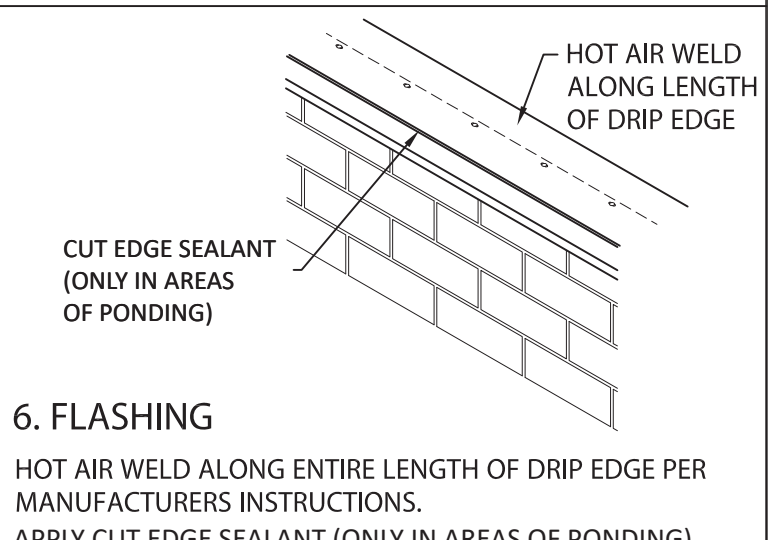

6. FLASHING

HOT AIR WELD ALONG ENTIRE LENGTH OF DRIP EDGE PER MANUFACTURERS INSTRUCTIONS. APPLY CUT EDGE SEALANT (ONLY IN AREAS OF PONDING)



Phone: 800-558-2162
 Fax: 800-373-9156
www.metalera.com/genflex

DATE: 06/14/21
 DRN BY: JJC
 CKD BY: MM

SHT.# 1 OF 2
 DWG# 22110-36398

A


GENFLEX TPO SKIRTED DRIP EDGE

TPO VERSION WITH FACTORY APPLIED TPO FLASHING WITHOUT CONTINUOUS CLEAT

NOTE: INSTALL MITERS FIRST

INSTALLATION INSTRUCTIONS

TYPICAL INSTALLATION

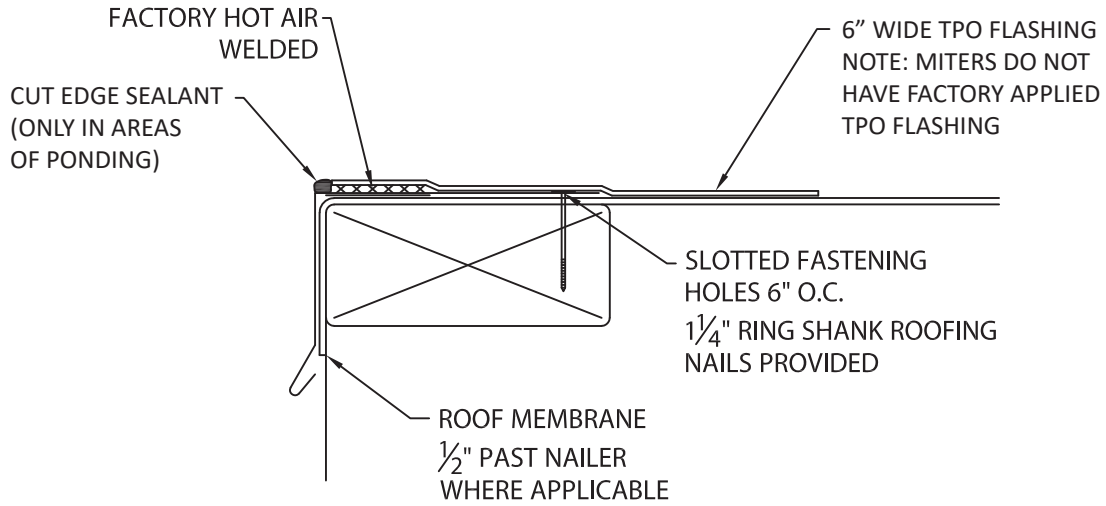

Phone: 800-558-2162
Fax: 800-373-9156
www.metalera.com/genflex

DATE: 06/14/21
DRN BY: JJC
CKD BY: MM

SHT.# 2 OF 2

DWG# 22110-36398

A